

# Manhole Inspection Summary

Manhole # S35K\_\_032MH

Printed On: 3/13/2009

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **5) Immediate Attention Required**

Record Plat: **35K** Node: **032** Status: **Found**

Insp Date: **1/22/09 1:27 PM**

Incomplete Comments

Crew: **dd**  
Inspector: **jjoiner**  
Firm: **ATS**

**Location** Address: **e. conway st**

Cross Street: **Light st**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **8** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☐ Mortar ☐ Roots ☒ **Wall**

**Bench**

☐ Exists Material:

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **6** Missing: **0** ☒ **Corroded**

**Surcharge**

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S35K\_\_032MH

Printed On: 3/13/2009

Page 2 of 5


Location View



Top View



Misc

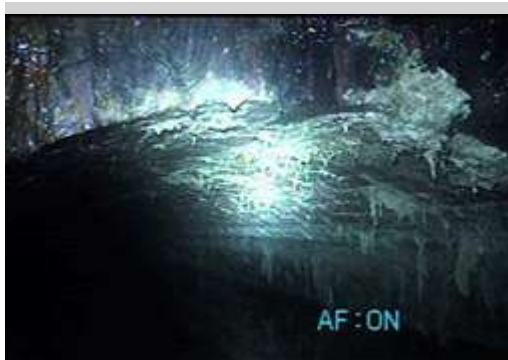

Pipe In @ 6 OClock:right side

Misc



Pipe Out @ 12 OClock:left side

Defect 4



barrel loose bricks

Defect 3



barrel infiltration at wall

# Manhole Inspection Summary

Manhole # S35K\_\_032MH

Printed On: 3/13/2009

Page 3 of 5

Defect 2



barrel cracked, infiltration through crack

Defect 1



steps corroded

## Manhole Inspection Summary

Manhole # S35K\_\_032MH

Printed On: 3/13/2009

Page 4 of 5

66 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



right side of pipe

Pipe Height: 0 (in.) Direct

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **13.58** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

12 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow

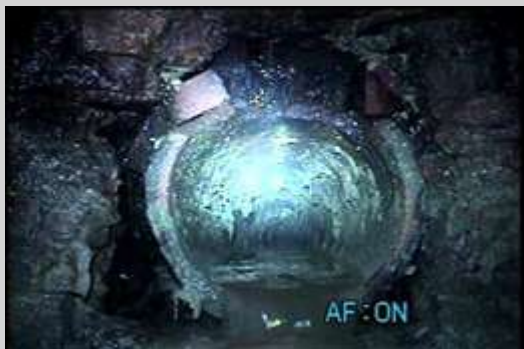

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.41** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S35K\_\_032MH

Printed On: 3/13/2009

Page 5 of 5

66 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



left side of pipe

Pipe Height: 0 (in.) Direct

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **13.50** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.10** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection